

Grease Interceptor Maintenance Log
Anchorage Public School

Date of Service	Service Provider	Volume Removed (Gallons)	Disposal Location	Next Scheduled Service	Notes/Observations
11/27/24	Losson Excavating, Septic & Drain (HMC)	1,500.00	Deerwood Environmental	before 2/25/2025	<p>Inlet pipe did not have a Tee baffle - entire pipe was under water and allowing solids to back up into the line. Outlet side did have a Tee but it was not low enough into the pit. This is also allowing solids to flow out of the grease trap and into the sanitary sewer. Both of these will need to be corrected.</p> <p>Jetted from the inlet towards the kitchen and pulled back a lot of debris. Ran jetter through multiple clean outs inside the kitchen. As the debris entered the grease trap, Losson pumped it out. Jetted from the outlet side all the way to its tie in point at the 6" sewer main. This was originally holding water but after jetting all water successfully drained down. Jetted a portion of the 6" sewer main through the 6" clean out located in the sidewalk. Jetted towards the building and pulled debris back to lift station.</p>